
START NEW JOB SETUP

Select the **Menu**, **Start Job**, then **New Job** buttons.





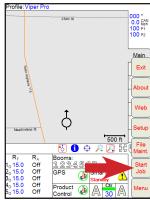

NAME THE JOB & ENABLE JOB FEATURES (OPTIONAL)

Select the **Delete**







or **Delete All** + button to rename the job.









Select job features to be activated. All three options are selected for typical applications. Select the **Next** button when finished.

CHOOSE SWATH PATTERN

Select either Straight AB, Contour Fixed, Pivot, or Last Pass for the initial swath pattern. A different swath pattern may be selected later in the job screen. Select the **Next** button when finished.

Initial Swath Pattern	Switch To Pattern	Switch Back To Pattern
Straight AB, Contour Fixed, or Pivot	Last Pass	Straight AB
Last Pass	Straight AB	Last Pass

ENABLE ACCUBOOM (IF INSTALLED)

AccuBoom Control must be selected on the first job set up page for this option to show. Select the **Next** button when finished.



Standard AccuBoom	Apply in unapplied areas; do not apply in previously applied areas	
Create Map	Ability to record and save an application map (spray/no spray zones, field boundary with buffer zone, etc.)	
Load Map	Load a previously recorded application map	
Create Map from Field Boundary	Load a previously recorded field boundary and add a buffer zone	

PRODUCT SELECTION

Select the number of products being used if a multi-product setup. If doing a granular application, can **Enable Product Chaining**. Select the **Next** button.

PRODUCT SETUP

Add a *Product Name* or choose a previous one from the drop down list. If doing

Booms All Chemical 1 VRC Using Default Colors Select Browse **|**++|← s d f g h j k l

variable rating then select **VRC**. Change the map template for rate zone colors by the **Select** button for *Using Default Colors* (optional). **Browse** for the prescription map that has been loaded into memory. Select the rate column (Rate, DAP, UREA, for example) from the .dbf file of the prescription map. Select the **Next** button to set up the other products in a multi-product setup. Select the **OK** button when finished to start the job. Place product control into Manual or Automatic from the main run screen

